

INSTRUCTION SHEET



Push in Socket Operating Instructions SJ Series

Type No. SJ1S-21L, SJ2S-21L

Read this instruction sheet to make sure of correct operation before starting installation, wiring, operation, maintenance, and inspection of this product. Also make sure that this instruction sheet is kept by end users. Special electrical expertise is required to install, wire, and operate the SJ series sockets. People without such expertise must not use the SU series sockets.

Safety Precautions

All SJ Series sockets are manufactured under IDEC's rigorous quality control system, but users must add a backup or failsafe provision to the control system using the SJ series sockets in applications where heavy damage or personal injury may be caused in case the SJ series sockets should fail.

In this instruction sheet, safety precautions are categorized in order of importance to Warning and Caution:

Varning notices are used to emphasize that improper operation may cause severe personal injury or death.

⚠ CAUTION

ution notices are used where inattention might cause personal injury or damage to equipment.

Turn off power to the SJ series sockets before starting installation, removal, wiring, maintenance, and inspection of the SJ series sockets. Failure to turn power off may cause electrical shocks or fire hazard.

⚠ CAUTION

- •Use proper wires to meet the voltage and current requirements
- •Make sure that relay and output equipment are connected completely.
- Incomplete connection may cause overheat, resulting in fire hazard.
- To ensure safety, make sure that all descriptions in the operation instructions are followed strictly.
 Prevent metal fragments and pieces of wire from dropping inside the SJ series sockets.
- Ingress of such fragments and chips may cause fire hazard, damage, or malfunction.

 •When disposing of the SJ series sockets, do so as an industrial waste.
- Do not disassemble, repair, or modify the SJ series sockets.
- Make sure that wires are connected correctly. Incorrect connection may cause malfunction, overheat, or fire hazard.

1 Wiring Instructions

When wiring, use the applicable wires shown below.

Applicable Wire (straned and solid)	0.14 to 1.5 mm²(AWG26 to 16)
Wire Stripe Length (When the ferrule is not used)	10 to 11mm (* 1)
Ferrule	Refer to" Wire Size and Recommended Ferrule "
***** *** *** *** *** *** *** *** ***	



(*1) Strip the sheath of the wire 10 to 11 mm from the end.

anded Ferrules

Wife Size and Reconfinenced Ferrules					
Applicable Wire (stranded)		Wire Strip Length	With insulation cover		
AWG	mm²		Order number		
26	0.14	10 to 11 mm	S3TL-F014-12WC		
24	0.25	10 to 11 mm	S3TL-H025-12WJ		
22	0.34	10 to 11 mm	S3TL-H034-12WT		
20	0.50	10 to 11 mm	S3TL-H05-14WA		
		12 to 13 mm	S3TL-H05-16WA		
18 0.75		10 to 11 mm	S3TL-H075-14WW		
		12 to 13 mm	S3TL-H075-16WW		
18 1.00 10 to 1		10 to 11 mm	S3TL-H10-14WY		
		12 to 13 mm	S3TL-H10-16WY		
16	1.50	10 to 11 mm	-		

Recommended Tools (Optional)

Name	Type No.	Order number	Appricable wire			
	S3TL-CR04T	S3TL-CR04T	0.5-4mm ²			
Crimping tool	S3TL-CR06D	S3TL-CR06D	0.25-6mm ²			
	PZ6 ROTO L(*)		0.14-6mm ²			
Flat blade screwdriver	S3TL-D04-25-75	S3TL-D04-25-75				
Stripper	S3TL-ST06	S3TL-ST06	0.08 - 6mm ²			


(*) :Manufactured by Weidmuller

Refer to the table below for other companies' ferrules that correspond to "Wire Size and Recommended Ferrules". Check each company's catalog for details and select.

Applicable Wire Weidmuller		PHOENIX CONTACT		WAGO			
(strand	ed)	Without	With	Without	With	Without	With
AWG	mm ²	insulation cover	insulation cover	insulation cover	insulation cover	insulation cover	insulation cover
26	0.14	-	H0.14/12 GR SV	-	AI 0.14-8 GY-1000	-	-
24	0.25	-	H0.25/12 HBL	-	AI 0.25-8 YE	-	FE-0.25-8N-YE
22	0.34	-	H0.34/12 TK	-	AI 0.34-8 TQ	-	FE-0.34-8N-TQ
20	0.50	H0.5/10	H0.5/14 OR	A 0.5-8	AI 0.5-8 WH	FE-0.5-8	FE-0.5-8N-WH
		-	H0.5/16 OR	A 0.5-10	AI 0.5-10 EH	FE-0.5-10	FE-0.5-10N-WH
18	0.75	H0.75/10	H0.75/14 W	A 0.75-8	AI 0.75-8 GY	FE-0.75-8	FE-0.75-8N-GY
		-	H0.75/16 W	A 0.75-10	AI 0.75-10 GY	FE-0.75-10	FE-0.75-10N-GY
18	1.00	H1.0/10	H1.0/14 GE	A 1.0-8	-	FE-1.0-8	
		_	H1.0/16 GE	A 1.0-10	-	FE-1.0-10	-
16	1.50	H1.5/10	-	A 1.5-10	-	FE-1.5-10	-

♠ CAUTION

- Make sure that the stranded wires do not loosen when using wiring without ferrules.
- Note the crimping dimensions, when using tools other than the recommended crimping tool. Please see 3-3 for details.
 Use a flat blade screwdriver with a blade size of 0.4×2.5mm.

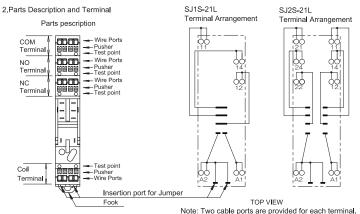

Ferrule

using a stranded wire, insert the wire while

pressing the pusher with a flathead screwdriver. Stranded wire (Flathead screwdriver

3-2.Removing the wire

Pushing the pusher with a flathead screwdriver, remove the wire straight in the arrow direction.



⚠ CAUTION

- After wiring, tug lightly to make sure that the wire is properly connected.
 Operate the pusher with a force of 40N. Do not press excessively.
- •Do not pull the wire out without depressing the pusher. When pulling the wire, be sure to pull in a straight direction. Otherwise, the socket may be damaged.
- Use a recommended flat blade screwdriver with the blade size of 0.4×2.5mm.
 3-3.Cautions on ferrule crimp shape and connection

⚠ CAUTION

- Choose an appropriate ferrule for the wire.
 Cut the wire carefully to get a flat end.
- Make sure that ferrule sleeve is completely filled by the conductor.

 Depending on the cross section, the conductor should protude. approx. 0 to 1 mm from the ferrule sleeve.
- When crimping, refer to the instructions of the crimping tool.
- Maximum connectable crimping size is W2.4×H1.9.
- Make sure that the ferrule size will be smaller than this dimension.

 •If a tool other than the recommended crimping is used, the ferrule
- may not be crimped to the appropriate size and the clamp or spring inside the socket may be deformed and may not operate normally.
- Pin crimp terminals cannot be used.

4.Installing / Removing the relay


- 4-1.Installing the relay(1) Tilt the release lever (2) Insert the relay and in the direction of the arrow and release the

tilt the release lever in the direction of arrow.



4-2.Removing the relay Remove the relay by tilting the release lever in the direction of the arrow while holding it lightly with fingers so that it does not fall.


(Relay installation state) (Relay release state)

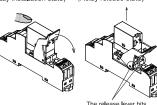

0 to1mm

⚠ CAUTION


Push the relay until it is completely installed. If the mounting is incomplete, the relay may fall off. (Relay installation state)

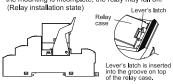

5.Installing the Marking Plate

Install the marking plate as shown in the diagram below. Mark on the durface using an oil-based marker, or affix a sticker with markings.

The size of the marking surface is 8.4mm × 15mm.

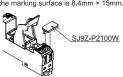


↑ CAUTION

- When removing the relay, the relay may pop out and the relay may be lost. Remove it while preventing it from popping out with your fingers.

 The release lever has a detachable structure.
- If it is operated with excessive force, it will come off the socket, causing the relay to fall off or be damaged.


6. Using the Jumper


Insert the jumper to the back of the jumper slot. To remove, insert the flat blade driver into the slot below and pull out. The rated current is 2A, so use it at 2A or less.

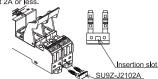

7.Installing the Relaese level


When using SJ9Z-C21R release lever, attach the release lever to approriate protrusion of the socket. To

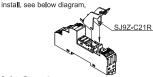

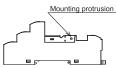

8.Safety Precaution 8-1. When using with RJ series relay, check the derating in the table below before using.

10 20 30 40 50

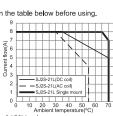

8-2. When using RF2S (forced guide relay), use a voltage of 150V or less.

⚠ CAUTION

- When used at a voltage higher than 150V, it does not satisfy the reinforced insulation performance of the forced guide relay.
 - 3.Rail Mounting and Removing

⚠ CAUTION

- When mounting the socket on a DIN rail, be sure to fix both sides with End Clip BNL6 (option).
 Do not mount the socket on the rail and remove the socket from the rail at temperatures below -20°C, otherwise the socket may be damaged
- 9.Disposal Precautions Usage Precautions

⚠ CAUTION

•When disposing of this product, treat it as industrial waste

CORPORATION

http://www.idec.com

Manufacturer: IDEC CORPORATION, 2-6-64 Nishimiyahara, Yodogawa-Ku, Osaka 532-0004, Japan EU Authorized Representative: APEM SAS

55. Avenue Edouard Herriot BP1, 82303 Caussade Cedex, France UK Authorized Representative: APEM COMPONENTS LIMITED Drakes Drive, Long Crendon, Buckinghamshire, HP18 9BA, UK